

FALSE PROCEED SIGNAL REPORT

REPORT FOR (month/year)
12/12/2000

All Railroads subject to Regulations of the Federal Railroad Administration shall submit a false proceed signal report, original only, to the Federal Railroad Administration within five days after a false proceed occurs. If no false proceed occurs during any calendar month, a report showing "No Failures" must be filed within ten days after the end of the month. Copies of this form will be furnished upon request to the Department of Transportation, Federal Railroad Administration, Office of Safety, Washington, D.C. 20590

REPORTING CARRIER (railroad and region or division)
**CSX
Transportation
Train Control**

MAIL TO

Federal Railroad Admin.
61 Forsyth St SW
Suite 16T20
Atlanta, Ga. 30303

REPORTING CARRIER (signature/title)

Director Signal Reliability

A failure should not be counted more than one time in items 1, 2, 3, and 4; the failure should be classified under the basic system or appliance of which it forms an essential part. E.g.; assume grounds cause a block signal to indicate a false proceed causing corresponding indications of a cab signal system on each train approaching this point, such failures should be included in item 1, Block System.

The following abbreviations may be used in the report.

- A-Automatic
- AB-Automatic block
- ACS-Automatic cab signal
- APB-Absolute permissive block
- ATC-Automatic train control
- ATS-Automatic train stop
- CL-Color light
- CPL-Color position light
- E-Electric
- EM-Electromechanical
- EP-Electropneumatic
- FP-False proceed
- MB-Manual block
- M-Mechanical
- P-Pneumatic
- PL-Position light
- SA-Semiautomatic
- TC-Traffic control


A false proceed failure is a failure of a system, device or appliance to indicate or function as intended which results in less restriction than intended.

TYPE OF SYSTEM	DATE	LOCOMOTIVE NUMBER	DEVICE THAT FAILED	LOCATION (city and state)
1 BLOCK SYSTEMS <input type="checkbox"/> AB <input type="checkbox"/> APB <input checked="" type="checkbox"/> TC	12/12/2000	M742-11	#6 Dwarf Signal	N.E. Live Oak Live Oak , FL
2 INTERLOCKING <input type="checkbox"/> AUTO-MATIC <input type="checkbox"/> REMOTE <input type="checkbox"/> MANUAL				
3 AUTOMATIC SYSTEMS <input type="checkbox"/> ATS <input type="checkbox"/> ATC <input type="checkbox"/> ACS				
4 OTHER (specify)				

NATURE AND CAUSE OF FAILURE/CORRECTIVE ACTION TAKEN

At approximately 0040 on December 12, 2000, Train M742-11 backed southward into the siding at the North End of Live Oak MP SP 713.4 on the Tallahassee Subdivision. When the switch into the siding was restored to normal, the crew observed that the dwarf signal governing movement out of the siding displayed a Red over Yellow (Medium Approach) signal. The Signal was removed from service and Train Control personnel were dispatched.

The cause was found to be a jumper which had been installed the previous day to set the lamp voltage on the Yellow aspect after replacing the dwarf signal, which had been damaged by track equipment. This jumper caused the Yellow aspect to be continuously illuminated. The jumper was removed, signal tests were made with no exceptions, and the signals were returned to service.

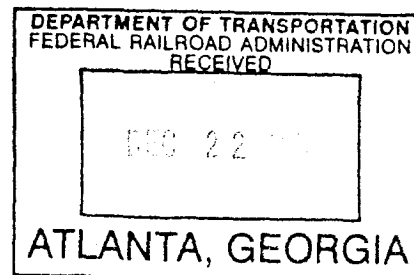

7